

ESTCP Cost and Performance Report

(CP-0118)



Aboveground Storage Tank (AST) Leak Detection and Monitoring

May 2004



ENVIRONMENTAL SECURITY
TECHNOLOGY CERTIFICATION PROGRAM

U.S. Department of Defense

Report Documentation Page				Form Approved OMB No. 0704-0188	
Public reporting burden for the collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to a penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.					
1. REPORT DATE MAY 2004		2. REPORT TYPE		3. DATES COVERED 00-00-2004 to 00-00-2004	
4. TITLE AND SUBTITLE Aboveground Storage Tank (AST) Leak Detection and Monitoring				5a. CONTRACT NUMBER	
				5b. GRANT NUMBER	
				5c. PROGRAM ELEMENT NUMBER	
6. AUTHOR(S)				5d. PROJECT NUMBER	
				5e. TASK NUMBER	
				5f. WORK UNIT NUMBER	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) Environmental Security Technology Certification Program (ESTCP), 4800 Mark Center Drive, Suite 17D08, Alexandria, VA, 22350-3605				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)				10. SPONSOR/MONITOR'S ACRONYM(S)	
				11. SPONSOR/MONITOR'S REPORT NUMBER(S)	
12. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution unlimited					
13. SUPPLEMENTARY NOTES					
14. ABSTRACT					
15. SUBJECT TERMS					
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT Same as Report (SAR)	18. NUMBER OF PAGES 43	19a. NAME OF RESPONSIBLE PERSON
a. REPORT unclassified	b. ABSTRACT unclassified	c. THIS PAGE unclassified			

COST & PERFORMANCE REPORT

ESTCP Project: CP-0118

TABLE OF CONTENTS

	Page
1.0 EXECUTIVE SUMMARY	1
2.0 TECHNOLOGY DESCRIPTION	3
2.1 TECHNOLOGY DEVELOPMENT AND APPLICATION	3
2.2 PROCESS DESCRIPTION	6
2.3 PREVIOUS TESTING OF THE TECHNOLOGY	7
2.4 ADVANTAGES AND LIMITATIONS OF THE TECHNOLOGY	7
3.0 DEMONSTRATION DESIGN	9
3.1 PERFORMANCE OBJECTIVES	9
3.2 SELECTION OF TEST SITES	9
3.3 TEST FACILITY HISTORY/CHARACTERISTICS	10
3.3.1 DEM/VAL 1: Fairchild Air Force Base	10
3.3.2 DEM/VAL 2: FISC Pearl Harbor (Third-Party Evaluation)	10
3.4 PHYSICAL SET-UP AND OPERATION	11
3.4.1 DEM/VAL 1: Fairchild Air Force Base	11
3.4.2 DEM/VAL 2: FISC Pearl Harbor (Third-Party Evaluation)	12
3.5 MONITORING PROCEDURES	14
3.6 ANALYTICAL PROCEDURES	14
4.0 PERFORMANCE ASSESSMENT	15
4.1 PERFORMANCE DATA	15
4.2 PERFORMANCE CRITERIA	15
4.3 DATA ASSESSMENT	15
4.3.1 Third-Party Evaluation Results	15
4.3.1.1 FISC Pearl Harbor Test Results	15
4.3.1.2 Performance Estimates for a Single Test (LRDP-24)	17
4.3.1.3 Performance Estimates for More Than One Test (LRDP-24-n)	18
4.3.1.4 Summary of Performance Results for Different Size Bulk ASTs	18
4.3.2 Results of the DEM/VAL of the LRDP in a Fixed-Roof Tank with a Floating Pan	19
4.4 TECHNOLOGY COMPARISON	21
5.0 COST ASSESSMENT	23
5.1 COST REPORTING	23
5.2 COST ANALYSIS	23
5.3 COST COMPARISON	25

TABLE OF CONTENTS (continued)

	Page
6.0 TECHNOLOGY IMPLEMENTATION	29
6.1 COST OBSERVATIONS	29
6.1.1 Cost Avoidance	29
6.1.2 Commercialization and Technology Transfer	30
6.2 PERFORMANCE OBSERVATIONS.....	30
6.3 SCALE-UP	30
6.4 OTHER SIGNIFICANT OBSERVATIONS.....	31
6.5 LESSONS LEARNED.....	31
6.6 END-USER ISSUES	31
6.7 APPROACH TO REGULATORY COMPLIANCE AND ACCEPTANCE	32
7.0 REFERENCES	33
APPENDIX A POINTS OF CONTACT.....	A-1

FIGURES

	Page
Figure 1.	Low-Range Differential Pressure (LRDP) System for ASTs4
Figure 2.	Photograph of the FISC Pearl Harbor Tank Used to Evaluate the LRDP System..10
Figure 3.	Level and Shell Temperature Data Obtained with the LRDP-24 System During Pre-Evaluation LRDP Tests16
Figure 4.	Least-Squares Lines Fitted to the Test Results of the LRDP-24.....16
Figure 5.	Height-to-Volume Calibration Test Results for the 54-ft-Diameter Fixed-Roof AST with a Floating Pan.....19
Figure 6.	Computation of the HVC from the Calibration Measurements Shown in Figure 7.....20
Figure 7.	Results of the First Test Conducted by KWA without Introducing an Induced Leak20

TABLES

	Page
Table 1.	Summary of the Two Methods of the LRDP System for Bulk Tanks5
Table 2.	Summary of the Third-Party Evaluation Test Results Obtained in a 164.5-ft-Diameter AST at FISC Pearl Harbor.....13
Table 3.	Mean and Standard Deviation of the Difference Between Measured Leak Rates (Test Results) and Induced Leak Rates for the LRDP-2417
Table 4.	Estimate of the MDLR for the LRDP-24 in a 164.5-ft Diameter AST17
Table 5.	Largest Tank Diameter That Can Be Tested with a $P_D = 95\%$ and a P_{FA} 5% as a Function of Leak Rate and Number of Tests (n) Averaged Together19
Table 6.	Summary of the Costs of the Two DEM/VALs of the LRDP System.....23
Table 7.	Compliance Monitoring Technology Costs for the LRDP on a per Tank Basis24
Table 8.	Cost Comparison of Testing with Monthly Monitoring and Annual Precision Test for First and Additional Bulk ASTs at a Single Facility or Fuel Farm for the First Year27
Table 9.	Cost Comparison of Testing with Monthly Monitoring and Annual Precision Test for the First Bulk AST at a Facility for 1, 3, 5, and 10 Years28
Table 10.	Cost Comparison of Testing with Monthly Monitoring and Annual Precision Test for Six Bulk ASTs at a Facility for 1, 3, 5, and 10 Years28

ACRONYMS AND ABBREVIATIONS

AFB	Air Force Base
API	American Petroleum Institute
ASTM	American Society for Testing and Materials
AST	aboveground storage tank
ATG	automatic tank gauge
CERF	Civil Engineering Research Foundation
DEM/VAL	demonstration/validation
DESC	Defense Energy Support Center
DoD	Department of Defense
DP	differential pressure
DQI	data quality index
EPA	Environmental Protection Agency
ESTCP	Environmental Security Technology Certification Program
EvTEC	Environmental Technology Evaluation Center
FA	false alarm
FAS	Fuels Accounting System
FISC	Fleet Industrial Service Center
GUI	graphical user interface
HVC	height-to-volume conversion
KWA	Ken Wilcox Associates, Inc.
LRDP	low-range differential pressure
LUFT	leaking understand fuel tank
MDLR	minimum detectable leak rate
NAS	Naval Air Station
NFESC	Naval Facilities Engineering Service Center
NWGLDE	National Work Group on Leak Detection Evaluations
O&M	operation and maintenance
P _D	probability of detection
P _{FA}	probability of false alarm
P _{MD}	probability of missed detect

ACRONYMS AND ABBREVIATIONS (continued)

PLC	programmable logic controller
PSA	product surface area
RTD	resistance temperature device
SPCC	Spill Prevention, Control and Countermeasure
TCVR	temperature-compensated volume rate
TLR	target leak rate
UST	Underground Storage Tank

ACKNOWLEDGEMENTS

The LRDP team would like to acknowledge and thank the fuel farm directors and their staff at the Fairchild Air Force Base (AFB), Spokane, Washington, and the Fleet Industrial Services Center (FISC), Pearl Harbor, Hawaii, for making their facilities available for the DEM/VALs of the LRDP, and for coordinating and supporting the DEM/VALs. Ken Wilcox Associates, Inc., performed the third-party evaluation of the LRDP. The work described in “Aboveground Storage Tank (AST) Leak Detection and Monitoring” was funded through the Environmental Security Technology Certification Program (ESTCP) and is a follow-on to the ESTCP project that demonstrated and validated the LRDP for use in bulk underground storage tanks (USTs), “Validation of the Low Range Differential Pressure (LRDP) Leak Detection System for Small Leaks in Bulk Fuel Tanks.” The LRDP team would especially like to thank Dr. Jeffrey Marqusee and Dr. Robert Holst for their support.

The development of this technology was made possible through the Navy’s Pollution Abatement Ashore Program managed by the Naval Facilities Engineering Command and sponsored by the Environmental Protection, Safety and Occupational Health Division (N45) of the Chief of Naval Operations, and the Preproduction Initiative Program. The LRDP was initially developed by Naval Facilities Engineering Service Center (NFESC) and Vista Research, Inc. This work was performed by Vista Engineering Technologies, L.L.C., the NFESC, and Vista Research, Inc. The following persons performed the work:

Project Manager:	Leslie A. Karr, REM NFESC
Project Engineer:	William R. Major NFESC
Technical Director:	Dr. Joseph W. Maresca, Jr. Vista Engineering Technologies, L.L.C.
Design/Field Engineers:	William R. Pickett Vista Engineering Technologies, L.L.C. James W. Starr, P.E. Vista Research, Inc.

Technical material contained in this report has been approved for public release.

1.0 EXECUTIVE SUMMARY

The Naval Facilities Engineering Service Center (NFESC), Port Hueneme, California, and its industrial partners, Vista Engineering Technologies, L.L.C., and Vista Research, Inc., have demonstrated and validated (an innovative, mass-based leak detection system for aboveground storage tanks (AST). The Low-Range Differential Pressure (LRDP) system is a computer-controlled system that can reliably detect small leaks in ASTs, which range from 50,000 gal to ASTs with diameters of over 260 ft containing over 10,000,000 gal of petroleum fuel. While no specific national regulatory requirements presently exist for ASTs, stringent state requirements are forcing Department of Defense (DoD) facilities to take their tanks out of service to install double bottoms and perform interstitial monitoring. With a validated, high-performance, in-tank leak-detection system for ASTs, like the LRDP, an alternative strategy is now available that is cost-effective and does not necessitate taking the tank out of service. The results of the evaluation showed that the LRDP has the performance to meet the monthly monitoring and annual precision (tightness) test regulatory compliance requirements set for bulk underground storage tanks (USTs) using a test that takes less than 24 h to conduct.

This project was performed under the Environmental Security Technology Certification Program (ESTCP). The objective of the ESTCP is to demonstrate and validate innovative environmental technologies needed to address the environmental objectives of the DoD, are cost-effective and will be ready for the development of commercial products and services at the completion of the demonstration/validation (DEM/VAL). All the objectives of the project have been met, and the LRDP is ready for and currently in commercial use. Both on-line, permanently installed monitoring and testing systems and tightness testing services using the LRDP can be obtained commercially through Vista Research. The results are described in the ESTCP Final Report and a published paper [1,2].

In a previous ESTCP project, the LRDP was demonstrated and validated for bulk USTs in a 122.5-ft-diameter bulk UST containing 2,100,000 gal of fuel at the Point Loma Fuel Terminal, San Diego, California. The LRDP used in this AST evaluation is identical to the one used in previous bulk UST DEM/VALs, except a temperature sensor was added to the outside wall of the tank and the test protocol was changed to require that the test begin and end at night.

The LRDP system is fully automatic and comprises (1) an innovative, in-tank level sensing unit to measure temperature-compensated level changes in the tank, (2) a temperature sensor mounted on the external wall of the tank to compensate for the thermal expansion and contract of the wall during a test, (3) a remote test controller to collect and analyze the data from a test, and (4) a host computer to initiate, report, and archive the results of a test. The electronics meet Class 1, Div. 1 standards. The in-tank sensor can be installed through a standard 8-in-diameter opening without removing fuel from the tank. The LRDP system is compatible with the DoD Fuels Accounting System (FAS) and can be integrated with FAS to test all the tanks in a fuel farm or bulk storage facility.

Two AST DEM/VAL tests were conducted between September 2001 and September 2002. The objective of the first DEM/VAL was to demonstrate that the LRDP can be used to test fixed-roof ASTs with floating pans. This DEM/VAL was conducted in a 54-ft-diameter fixed-roof tank with a floating pan at Fairchild Air Force Base (AFB) between September 2001 and February

2002. The results of this DEM/VAL showed that the LRDP could be used to perform accurate tests in a tank with a floating pan.

The objective of the second DEM/VAL was to determine the performance of the LRDP in an AST through a third-party evaluation following an evaluation procedure developed by the third-party evaluator that was similar to and compliant with EPA's standard test procedure for bulk USTs. The results of the evaluation are reported in terms of leak rate, probability of detection (P_D), and probability of false alarm (P_{FA}). The third-party evaluation was performed by Ken Wilcox Associates, Inc. (KWA), a nationally recognized third-party evaluator. The evaluation consisted of 24 blind tests conducted on a 164.5-ft-diameter, 6,470,000-gal bulk AST containing jet fuel (JP-8) at the Fleet Industrial Service Center (FISC), Pearl Harbor, Hawaii. The tests were conducted over a wide range of ambient air temperature and induced leak conditions from June 19, 2002, through August 29, 2002. Leaks were induced in 11 of the tests.

The results of the third-party evaluation, which are presented in this report, indicate that in a single 20-h test the LRDP-24 can detect a leak of 0.932 gal/h with a P_D of 95% and a P_{FA} of 5% in a 164.5-ft diameter tank. The performance of the LRDP-24 scales with the product surface area of the tank (i.e., the tank diameter squared) and improves as the tank diameter decreases. The third-party evaluation results indicate that the LRDP-24 can detect leaks as small as 0.2 gal/h in a single test in a 76-ft-diameter tank with a $P_D = 95\%$ and a $P_{FA} \leq 5\%$. By conducting and averaging four tests, a 0.2-gal/h leak can be detected in a 108-ft-diameter tank with the same probabilities of detection and false alarm. For monthly monitoring purposes, the LRDP-24 can detect leaks as small as 1.0 gal/h in a single test in a 170-ft-diameter tank with a $P_D = 95\%$ and a $P_{FA} \leq 5\%$. In addition to a $P_{FA} = 5\%$, the LRDP can also be operated with P_{FAS} of 1%, 0.0016%, and $\ll 0.001\%$.

The LRDP can realize significant cost savings in three areas. First, the LRDP allows the DoD a very much less expensive alternative for meeting various regulatory requirements that now require DoD facilities to take their tanks out of service to install double bottoms and perform interstitial monitoring. Second, the LRDP is significantly cheaper to purchase, operate, and maintain than other leak detection technologies because of the low recurring cost of each test performed. It is the only mass-based system that can be used as an on-line monitoring system that can perform both monthly monitoring tests and annual precision tests. Due to the precision test capability of the LRDP for each tank brought into compliance, the LRDP can realize cost savings over other in-tank, mass-based automatic tank gauge (ATG) methods and other testing services using mass-based methods by a factor of 3:1 and 11:1, respectively, over a 10-year period. Due to the high recurring costs of in-tank tracer methods, the cost savings realized by the LRDP over these methods can be well over a factor of 5:1 over a 10-year period. The payback for a permanently installed LRDP is less than a year when compared to using an in-tank testing service or a tracer method. Thus, savings of up to several tens of millions of dollars can be realized for each DoD fuel storage facility. Third, in addition to the installation and operational cost savings, the LRDP has the potential to save DoD many hundreds of millions of dollars in terms of cleanup and tank replacement cost avoidance.

2.0 TECHNOLOGY DESCRIPTION

The LRDP system is an innovative technology originally developed for the reliable detection of small fuel leaks in the bulk USTs owned or operated by the DoD [3, 4]. If a tank is leaking, the LRDP quantitatively measures the leak rate in gallons per hour, the quantity of regulatory interest. The LRDP is a fully automatic, mass-based system and is easy to install and use. It can be permanently installed in a tank and used for on-line monitoring and precision (tightness) testing. It can also be used as a portable system for periodic testing of any tank in the fuel farm. The minimum duration of a test is 20 h.

The LRDP for bulk USTs was demonstrated and validated in a previous ESTCP project completed in 2001 [3, 4]. Under the current ESTCP project reported here, the LRDP was adapted for testing ASTs. Only two small but very important modifications were made. First, a temperature sensor was attached to the outside wall of the tank to compute the level changes associated with the thermal expansion and contraction of the wall. Second, the test was begun and ended at night (during darkness) so that the spatial variation in temperature due to direct solar heating and cooling on different parts of the tank could be minimized. Otherwise, the LRDP used in this AST evaluation is identical to the one used in the previous bulk UST evaluations.

The main source of error in testing ASTs for leaks, which was emphasized during the third-party evaluation, is produced by air temperature. The ambient diurnal temperature changes, which affect the thermal expansion and contraction of the fuel, the wall, and the instrumentation, may be 10 to 20°F per day (0.42 to 0.83°F/h), or more, for ASTs. In bulk USTs, ambient air temperature changes are not an important source of noise.

2.1 TECHNOLOGY DEVELOPMENT AND APPLICATION

The LRDP system is fully automatic and comprises (1) an innovative in-tank level sensing unit, (2) a temperature sensor mounted to the outside wall of the AST, (3) a programmable logic controller (PLC) or an embedded remote test controller to collect and analyze the data from a test, and (4) a host computer to initiate, report, and archive the results of a test. The in-tank sensor consists of a reference tube, which extends from the bottom of the tank to above the highest anticipated fuel level; a sealed container at the bottom of the reference tube, which houses the measurement sensors; and a valve at the bottom of the tube to allow fuel in the tank to enter the tube.

The preproduction prototype of the LRDP system for use in ASTs is shown in Figure 1. In Figure 1, the LRDP is shown being installed in the fixed-roof AST with a floating pan that was used in the first DEM/VAL. The level-measurement sensor is an off-the-shelf, industrial-grade differential pressure (DP) sensor located in a sealed container at the bottom of the in-tank sensing unit. Level measurements are made with a precision of 0.0002 in. Figure 1 also shows the tripod used to install the in-tank level sensing unit through an 8-in-diameter opening at the top of the tank. A test is initiated by an operator using the host computer. The PLC (i.e., remote test controller), located in close proximity to the tank, automatically operates the LRDP system. A test report is generated on completion of the test.

The test results are Pass, Fail, or Inconclusive. A volume rate (i.e., a leak rate) is reported only if the tank fails the test. An inconclusive test occurs if the data fail a data quality test, and it is recommended that the test be repeated. Data quality indices (DQI) have been developed for the LRDP, which are based on empirical data, and ensure that the data used to compute the test result are of sufficient quality for analysis. The DQIs verify that there were no product transfers, product sampling problems, data acquisition problems, or unusual weather conditions during the test. The LRDP system is compatible with the DoD FAS and can be integrated with FAS to test the tanks in a fuel farm or bulk storage terminal.

High performance is achieved with the LRDP system because the novel design of the in-tank sensing unit results in a very high precision for making level measurements with an off-the-shelf DP sensor and effective compensation of the thermally induced level changes produced by temperature changes of the fuel, the sensors, the tank, and the mounting system. Accurate compensation is obtained because the LRDP is specifically designed to compensate for each source of noise without the need for arrays of temperature sensors or delicate and expensive level sensors. As a consequence, all the sensors are off-the-shelf, commercially available sensors that have a proven track record of performance. The reference tube, a special bellows-mounting stand at the top of the tank, bottom-mounted sensors, and an externally mounted temperature sensor are the key elements that lead to high performance. Other mass-based systems do not work as well because (1) the sensors are mounted at the top of the tank where the top of the tank moves vertically in response to large diurnal swings in the ambient air temperature, (2) the thermal expansion and contraction of the shell is not accurately compensated, (3) the pressure

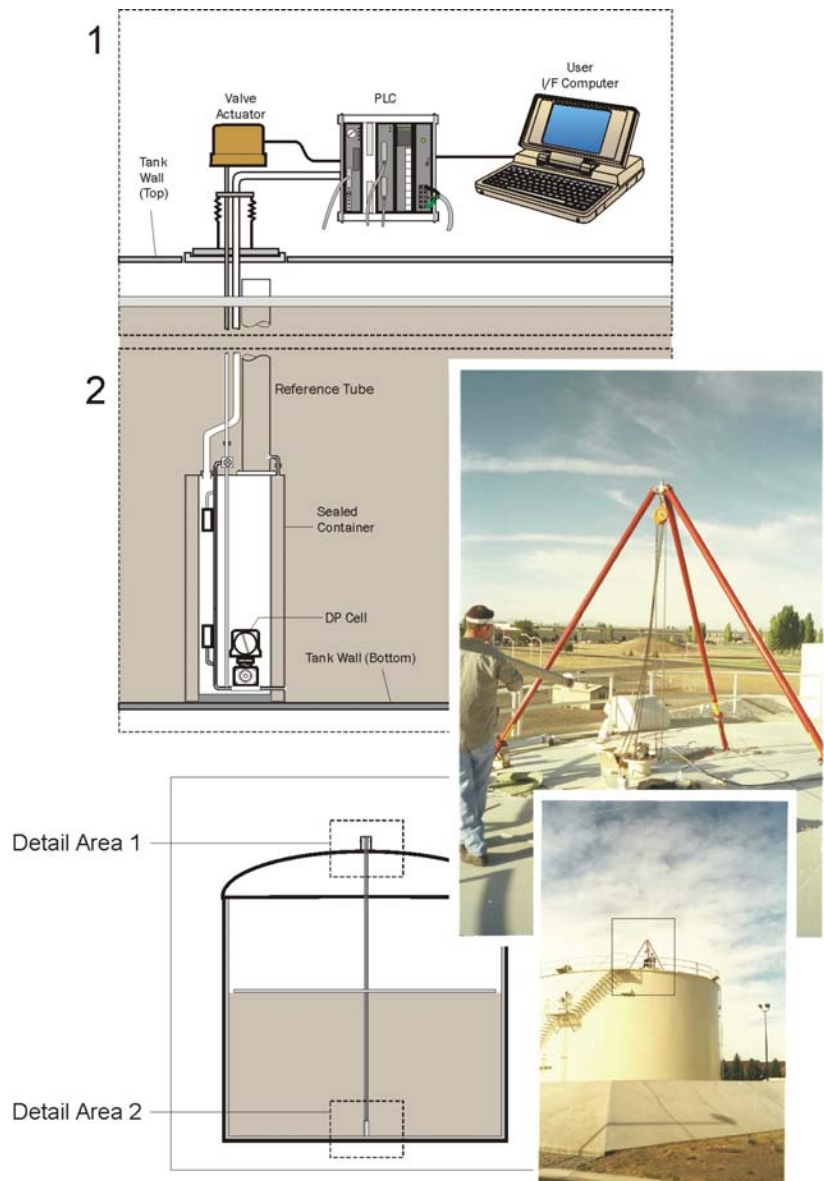


Figure 1. Low-Range Differential Pressure (LRDP) System for ASTs.

sensor is very delicate and expensive to achieve the level of precision required to conduct a test, and (4) the pressure sensor may require the use of nitrogen gas for operation.

A detailed description of the LRDP can be found in the Final Report [1]. A test is conducted after the valve at the bottom of the reference tube is closed. At the beginning of a test, the level of the fuel in the tube is identical to that in the tank. With the exception of a level change caused by a leak and the thermal expansion or contraction of the tank wall, the level of the fuel in the reference tube mimics the level of the fuel in the tank. The DP sensor measures the difference in the levels of fuel between the reference tube and the tank (which can be expressed in terms of gallons per hour based on a height-to-volume conversion (HVC) from the tank's strapping table). The volume change is then compensated for the thermal expansion and contraction of the tank wall. The output of a test is a temperature-compensated volume rate (TCVR).

For high performance, a test should begin and end at night, and it should be long enough to average through a diurnal cycle. The TCVR is obtained by using two 30-min periods of data at the start and end of the test. It was intended that the test duration would be 24 h. However, to minimize the time required to conduct the third-party evaluation, the test was shortened to 20 h. This allowed a test to begin and end during the night and still leave sufficient time to prepare different leak conditions during the evaluation.

Once the data are qualified and a test result, TCVR, is computed, there are various detection thresholds, T , are used to determine whether or not the AST has a leak. The detection threshold is set to maintain a specified P_{FA} and P_D of 95% against the target leak rate of regulatory or operational interest. The largest P_{FA} that can be used is 5%, but if possible, a P_{FA} of 1% or less should be used. The performance of the LRDP can be improved by averaging two or more tests together before applying the threshold, or by increasing the test duration. A test duration that extends through three night-time periods (two diurnal cycles) would give better performance than a test through only two night-time periods (one diurnal cycle).

Table 1 summarizes two general methods for conducting a test with the LRDP system that are designed to address the regulatory requirements summarized in Section 2.2. The name of the method contains the duration of the test in hours and the number of tests to be averaged. For ASTs, the LRDP-24 can be implemented with a test duration of 20-h or longer. A waiting period is not required as is typical for other in-tank leak-detection systems.

Table 1. Summary of the Two Methods of the LRDP System for Bulk Tanks.

Name of Test Method	Type of Test	Test Duration	Number of Tests Averaged Together
LRDP-24 Version 2	Monitoring, precision*	20 h	1 test
LRDP-24-n Version 2	Precision*	20 h	$1 < n \leq 24$ tests

* Can be used to address the regulatory standards for a 0.20-gal precision test.

The LRDP-24-n is a test that requires the averaging of “n” LRDP-24 tests. As determined from the third-party evaluation reported herein, both methods can be used to test vertical-walled tanks with capacities greater than 50,000 gal and with diameters less than 260 ft. Both the LRDP-24 and the LRDP-24-n can be used as a stand-alone monitoring and precision testing system or a portable precision testing system (as part of a testing service). The name of the method is designated as Version 2 to differentiate the performance of the LRDP-24 for ASTs from the

LRDP-24 for bulk USTs, which is designated as Version 1. For each method in Table 1, one of five *detection thresholds* is presented that can be used to detect a specific target leak rate (TLR) with a $P_D = 95\%$, or to operate with a specific $P_{FA} \leq 5\%$.

2.2 PROCESS DESCRIPTION

Mobilization. The LRDP system can be transported to a measurement site in its main component sections. The reference tube consists of two or more sections of flanged pipe, which can be assembled on site during installation.

Test Set-up. The LRDP system can be installed for a test, when used as a portable system, in less than 4 hours. It takes between 1-3 days for a permanent installation of the in-tank sensing unit.

Precision and Accuracy. A detailed discussion of the precision and accuracy of the LRDP is given in Section 4.

Regulations. In 1988, the U. S. Environmental Protection Agency (EPA) issued regulations that required periodic leak testing of USTs and their associated piping containing hazardous substances such as petroleum fuels that *deferred* the requirements for testing ASTs and field-erected (i.e., bulk) USTs for leaks [5], mainly because there were no viable technologies available in 1988 for accurately testing ASTs. As a consequence, none of the ASTs were required to meet the rigorous leak-detection performance standards for monthly monitoring or annual tightness testing established for the smaller, shop-constructed USTs typically found at retail petroleum service stations [5]. While an aboveground tank is defined as any tank with less than 10% of the volume of the fuel contained underground, the bottom or buried surface area of an AST with a diameter of 31.3 ft, a very small AST, has the same buried surface area as a 10,000-gal UST, one of the larger shop-constructed USTs found at many retail service stations.

While there are no federal leak-detection regulatory requirements for ASTs, it is safe to assume that the states will implement regulations or regulatory guidelines similar to those used for testing bulk USTs [6]. Also, while not required, the latest version of the Spill Prevention, Control and Countermeasure (SPCC) regulation strongly encouraged leak detection as part of each storage facility's inspection and maintenance plan [7]. Owners and operators of *field-erected, bulk USTs* and *hydrant systems* are now highly regulated; strong regulations for owners and operators of ASTs will soon follow. Even more importantly, there is an operational driver for implementing leak detection in ASTs. In most states, the regulatory environment requires ASTs to have double bottoms with leak detection in the interstitial space between the false existing and second bottom. As an alternative, these states will accept single-bottom tanks if reliable leak detection is permanently installed on the tank for routine monitoring and periodic precision testing. This option is very real and very attractive, because there is a cost savings of as high as 30:1 over that of double bottoms. Moreover, a major oil company has recently issued internal requirements to test their single-bottom ASTs every 2 years as compared to no testing.

Training. A field technician with experience in operating computer-controlled equipment can learn to operate the system in less than a day. The physical set-up of the equipment and the methods for mounting the LRDP in the tank is straightforward. The system checkout and use of

the software is also straightforward. The system is automatic and a test is initiated by clicking on the start button on the graphical user interface (GUI).

Health and Safety. The LRDP system is safe to use and poses no health risk to the user or the AST. The system requires 110 VAC power, but can be and was operated off a generator when used as part of a testing service.

2.3 PREVIOUS TESTING OF THE TECHNOLOGY

Over the past 6 years, the NFESC, in conjunction with its industrial partners, has developed, evaluated and implemented the LRDP leak-detection system for bulk USTs [3, 4]. The LRDP has been evaluated for performance by a third party following an EPA standard test procedure for bulk USTs [8, 9] and bulk ASTs [10]. Three separate third-party evaluations have been performed in tanks of different sizes, locations and climatic conditions. The evaluations were performed (1) in an 88-ft-diameter bulk UST containing 650,000 gal of fuel at the Naval Air Station (NAS) North Island [11, 12], (2) in a 122.5-ft-diameter bulk UST containing 2,100,000 gal of fuel at the Point Loma Fuel Terminal [3, 4], and (3) in the world's largest tanks having a diameter of 100 ft and containing 12,500,000 gal of fuel [13, 14]. The system has also been demonstrated on a 50,000-gal, shop-fabricated UST at the Hunter Army Air Field, Fort Stewart [3, 4]. The results of all three evaluations were similar and are consistent with the results of the LRDP obtained in this AST third-party evaluation [15]. The results of these evaluations have demonstrated that the LRDP, both as an on-line, permanently installed system and a portable system used as part of a testing service, has the performance to meet the very strict regulatory compliance standards in bulk USTs established for the highly regulated small USTs found at retail service stations and bulk USTs in California [5, 6].

2.4 ADVANTAGES AND LIMITATIONS OF THE TECHNOLOGY

The LRDP system has the following advantages for testing ASTs.

- The LRDP can be directly inserted into a standard 8-in-diameter opening in the tank and can be installed and used without removing fuel from the tank.
- The LRDP can be used to test a bulk ASTs in as little as 20 h, which is significantly shorter in test duration than other methods (48 to 72 h or longer).
- The output of a leak detection test is easy to interpret, because it is a direct measurement of the leak rate in gallons per hour, the quantity of regulatory and engineering interest.
- The LRDP system is the only mass-based system that can meet both the monthly monitoring and the semiannual or annual precision test regulatory guidelines required in California for testing bulk USTs.

The main limitation of the method is that all of the valves in the fuel facility that isolate the tank from its associated piping must seal completely. If closing the valves more tightly does not work, valve blinds may need to be installed to complete the test. The magnitude of this problem is not known for bulk ASTs, but it is the same problem encountered and successfully addressed for routine monitoring of USTs at service stations and bulk USTs at DoD facilities.

This page left blank intentionally.

3.0 DEMONSTRATION DESIGN

3.1 PERFORMANCE OBJECTIVES

The objective of this ESTCP project was to demonstrate and validate a reliable, cost-effective leak-detection system for monthly monitoring and periodic precision testing of the bulk aboveground storage tanks (ASTs) that are owned and operated by the DoD. This project was an expansion of the previous ESTCP project conducted for bulk USTs [3, 4, 14]. The DEM/VALs were designed to demonstrate the system on fixed-roof tanks with and without a floating pan and to have the performance documented in a third-party evaluation. The output of the project is a preproduction prototype of the LRDP leak detection system (1) that is ready for use by industry and (2) that has been evaluated for performance by an independent third party following a standard test procedure developed by the EPA and the American Society for Testing and Materials (ASTM) [9, 10].

The performance objectives of the DEM/VALs were established by the regulatory guidelines developed in California for detection of leaks in bulk USTs [6]. The bulk UST regulatory guidelines were used because quantitative standards for ASTs have yet to be developed. Furthermore, these regulatory standards are practical and very stringent.

The results of this evaluation are reported in terms of a P_D of a target leak rate (TLR) and a P_{FA} . At a minimum, the P_D must be equal to or better than 95% and the P_{FA} must be less than or equal to 5%. The TLRs for bulk USTs are typically 0.3 to 1.0 for monthly monitoring when a precision test at 0.2 gal/h is performed annually and 1.0 to 2.0 gal/h for monthly monitoring when the precision test is performed semiannually [6].

3.2 SELECTION OF TEST SITES

Since the LRDP leak detection system is not affected by soil conditions and site geology, four criteria were used in selecting sites for the DEM/VALs. The primary criteria for a demonstration site are AST size; type of tank, tank integrity, and tank availability; and base facility support. The first step was to perform the DEM/VAL in a tank with a large enough diameter to address all of the tanks used by DoD. The standard test procedure for bulk ASTs described in reference [10] allows the results of the evaluation for mass-based systems in a bulk UST to be used for any tank smaller than the tank used in the evaluation and any tank whose product surface area (PSA) is 250% less than the PSA of the evaluation tank. Second, the plan was to demonstrate that the system can be used in any type of tank owned by DoD. There are two basic types of AST — fixed-roof tanks and fixed-roof tanks with floating pans. Thus, two DEM/VAL sites were used, one with each type of tank. Third, the tanks used in the DEM/VALs had to be free of leaks, and it was preferable that no inflow or outflow caused by leaking valves occur during the evaluation. Two DoD facilities offered the use of their ASTs for the evaluation: FISC Pearl Harbor and Fairchild AFB.

FISC Pearl Harbor site was selected for the third-party evaluation because (1) the tanks storing fuel were of a large size, (2) the valves isolating the tanks from the transfer piping were new double-block and bleed valves whose integrity could be verified, (3) it was the most common type of AST owned and operated by DoD; and (4) the fuel farm needed and was interested in a

cost-effective system for testing the tanks at the facility. The Fairchild AFB site was selected for the DEM/VAL because the site had fixed-roof tanks, contained floating pans, and on-site support and interest in fielding a DEM/VAL.



Figure 2. Photograph of the FISC Pearl Harbor Tank Used to Evaluate the LRDP System.

3.3 TEST FACILITY HISTORY/CHARACTERISTICS

A brief description of the FISC Pearl Harbor and Fairchild AFB DEM/VAL sites is provided below. Both tanks have vertical walls and a sloping bottom.

3.3.1 DEM/VAL 1: Fairchild Air Force Base

The first DEM/VAL was conducted on Tank #2 of the KC-135 hydrant fueling system, which is adjacent to Pump House B. The tank is a 10,000-barrel (400,000 gal), 54-ft-diameter, fixed-roof AST (with a floating pan) at Fairchild AFB, Spokane, Washington. The main objective was to demonstrate that a fixed-roof AST with a floating pan could be reliably tested without resting the floating pan on its legs at the bottom of the tank.

3.3.2 DEM/VAL 2: FISC Pearl Harbor (Third-Party Evaluation)

The second DEM/VAL was conducted on Tank #56, a 150,000-barrel (6,470,000-gal), 164.5-ft-diameter fixed-roof AST at Pearl Harbor, Hawaii, and is one of the largest field-erected, bulk ASTs owned by DoD. The third-party evaluation was performed on this larger tank. The tank

was filled to a depth of 40.7 ft. and contained 6,470,000 gals of JP-5 fuel. The PSA of the tank is 21,253 ft². Level changes in this tank are converted to volume changes using a height-to-volume conversion factor of 13,248.6 gal/in. The sensitivity of the LRDP to product transfers in and out of the tank was tested by removing from the tank and then adding back more than 2,500,000 gal of fuel.

3.4 PHYSICAL SET-UP AND OPERATION

3.4.1 DEM/VAL 1: Fairchild Air Force Base

The primary objective of the DEM/VAL conducted at Fairchild AFB was to demonstrate that the system could be used to test fixed-roof tanks with floating pans for leaks. The LRDP was installed in the tank and checked out during the last week in September 2001. Representatives from Vista Engineering Technologies and Vista Research were present for the installation (and the removal). Approximately 5 months of data were collected to check out the LRDP and verify its operation in a tank with a floating pan. The tank contained 400,000 gal (95% of capacity) of JP-5 for these tests.

Figure 1 shows the LRDP being installed in the tank through the standard 8-in. opening in the top of the tank. The reference tube was installed in the 8-in.-diameter measurement fill tube. The fill tube extends from the top of the tank to the bottom of the tank and was located approximately one-third of the distance from the wall to the center of the tank. The bottom elevation of the fill tube is at the same elevation as the ground at the side of the tank. The bottom of the tank has about a 5° slope, which means the bottom of the tank is approximately 28 in. lower in elevation than the bottom of the fill tube. In this configuration, a differential pressure sensor will not completely compensate for the thermal expansion or contraction of the fuel because of the fuel below the pressure sensor. This problem could have been addressed by locating a temperature sensor at the bottom of the reference tube or by installing the reference tube at the center of the tank and appropriately shaping the bottom 3-ft of the tube to match the changing cross-sectional area of the tank. This was done for the tank at FISC Pearl Harbor.

Three types of tests were conducted. The first and most important test was to demonstrate that accurate level measurements could be made in a fixed-roof tank with a floating pan. A calibration test was performed. Measured volumes of product were removed from the tank and compared to the volumes measured with the LRDP using the HVC of the tank. The second test was to investigate the thermally induced volume changes of the wall. This was done using temperature sensors mounted to the external wall of the tank at the North, Southeast, and Southwest sides of the tank. The third type of test was to conduct a leak detection test.

The floating pan could degrade a test in two ways. First, the pan could partially stick on the side of the wall during a test. When the floating pan moves freely, the HVC is determined by the cross-section geometry of the product surface. If the pan sticks, the measured HVC would be many orders of magnitude larger than the actual HVC for the entire tank. Thus, when the pan is stuck, even small volume changes would produce excessively large height changes because of the small product surface area available for vertical movement as compared to the product surface area of the tank itself. As a consequence, it is relatively easy to identify any sticking of the pan. A leak detection test can be performed, even if the pan temporarily sticks during the test, if the pan is freely moving at the beginning and end of the test, or if the pan is stuck during

the entire test and the actual HVC has been measured for this condition. In any other condition it is difficult to assess the volume change during the transition periods.

3.4.2 DEM/VAL 2: FISC Pearl Harbor (Third-Party Evaluation)

The LRDP was installed in the tank and checked out during the second week of May 2002. Representatives from KWA, Vista Research, and Vista Engineering were present. The LRDP was installed in an 8-in. opening at the center of the tank (Figure 2). The 8-in.-opening with part of the LRDP mount in place and the bottom catch basket to keep the LRDP stable are shown in the photographs on the left and right, respectively. A special catch basket was installed in the tank when the tank was cleaned to ensure that the LRDP did not move when the transfer pumps, which were aimed directly at the LRDP, were turned on. The bottom 3 ft. of the reference tube was shaped to mimic the changing cross sectional area at the bottom of the tank due to the sloping bottom. The same tripod installation system was used on the FISC Pearl Harbor tank that was used on the Fairchild tank. The LRDP was installed and checked out in a day. The data from two 10-day data-collection periods were obtained in May and early June before the start of the evaluation to verify the system was function properly.

The performance of the LRDP was evaluated by KWA during tests conducted June 19 to August 29, 2002. Twenty-four tests were conducted, during which KWA randomly introduced leaks ranging from 0.0 to 2.0 gal/h. Neither the presence of the leaks nor their size was known to the vendor until all the evaluation tests and test results had been reported. The evaluation results are tabulated in Table 2.

KWA also examined whether the LRDP was sensitive to effects related to the filling of the tank; the results of the evaluation showed no adverse impact on the performance of the LRDP, even if a test was started immediately after the tank had been filled. The mean and standard deviation of the evaluation results were -0.004 gal/h and 0.272 gal/h, respectively. A statistical hypothesis at a level of significance of 0.05 showed that there was no statistically significant bias in the test results; as a consequence, the performance of the method is computed from only the standard deviation of the test results.

The bulk AST evaluation protocol [10] is similar to the bulk UST protocol [8], but there are two major differences. First, 24 tests were required by the AST protocol vice 12 tests for the UST protocol. Second, the requirement for at least six transfers was eliminated because such transfers do not affect mass-measurement systems. However, to demonstrate this, a special removal and additional of fuel to simulate a transfer was conducted. The additional tests were added to get a more representative set of ambient conditions than would be provided with only 12 tests and is consistent with the UST protocols for shop-constructed USTs.

The evaluation procedure requires that the evaluation be performed when the tank contains approximately 90% of capacity. Leaks were produced by pumping fuel out of the tank with a peristaltic pump. The protocol requires at least six leaks. Eleven leaks were generated by KWA. Leaks of approximately 0.5, 1.0 and 2.0 gal/h were randomly induced during the evaluation. This blind testing ensures the integrity of the evaluation.

Table 2. Summary of the Third-Party Evaluation Test Results Obtained in a 164.5-ft-Diameter AST at FISC Pearl Harbor.

Start Date	End Date	Compensated Test Result (CTR)	Induced Leak Rate (ILR)	Error = (CTR- ILR)
At 0530 HST	At 0130 HST	(gal/h)	(gal/h)	(gal/h)
6/19/2002	6/20/2002	-0.081	0	-0.081
6/20/2002	6/21/2002	-1.945	-1.902	-0.043
6/21/2002	6/22/2002	-0.214	-0.517	0.303
6/22/2002	6/23/2002	-1.626	-1.066	-0.560
6/23/2002	6/24/2002		-0.517	
6/24/2002	6/25/2002	-1.801	-1.869	0.068
6/25/2002	6/26/2002	-0.590	-0.851	0.261
6/26/2002	6/27/2002	-1.819	-1.75	-0.069
6/27/2002	6/28/2002	-0.946	-1.364	0.418
6/28/2002	6/29/2002	-0.738	-0.786	0.048
6/29/2002	6/30/2002	-1.403	-0.884	-0.519
6/30/2002	7/1/2002	-0.691	-0.391	-0.300
7/1/2002	7/2/2002	0.113	-0.089	0.202
7/2/2002	7/3/2002	0.295	0	0.295
7/3/2002	7/4/2002	-0.056	0	-0.056
7/4/2002	7/5/2002	-0.084	0	-0.084
7/5/2002	7/6/2002	-0.335	0	-0.335
7/6/2002	7/7/2002	-0.216	0	-0.216
7/7/2002	7/8/2002	0.114	0	0.114
8/23/2002	8/24/2002	0.271	0	0.271
8/24/2002	8/25/2002	0.238	0	0.238
8/25/2002	8/26/2002	-0.112	0	-0.112
8/26/2002	8/27/2002	0.250	0	0.250
8/27/2002	8/28/2002	0.165	0	0.165
8/28/2002	8/29/2002	-0.362	0	-0.362

Testing during the evaluation was accomplished by KWA personnel following the LRDP testing procedures specified by NFESC and Vista Engineering. Leak simulations and fuel deliveries were defined and monitored by KWA. Leaks were induced by KWA with a peristaltic pump through a valve located on the side of the tank. The LRDP system routinely monitored the results of each test. The output of each test was automatically output from the system. A test duration of 20 h was used. A test duration shorter than 24 h allowed a new test condition to be generated each day.

For bulk ASTs, the LRDP requires that a test be started and completed during darkness. Starting and ending the test at night minimizes the thermally induced changes to the wall of the tank and allows a single temperature sensor to be used for compensation. Accordingly, during the evaluation, KWA changed the induced leak rate each day at 0400. Induced leaks were generated for the first 11 tests. Given that it could take KWA anywhere between several minutes and up to 30 minutes to change the leak, Vista Engineering started and ended the test at 0530 and 0130, respectively. This ensured that the induced leak had been established for each test. No interruptions to the testing occurred during the evaluation.

For each test, the volume rate measured by the LRDP system was compared to the leak rate induced by KWA. Neither the nominal nor actual leak rate was made known to NFESC or Vista Engineering until many months after the evaluation had been completed and the final evaluation report was prepared. Leak rates were calculated from the total mass of fuel removed from the tank during the test and the density of the fuel that was measured with an analytical balance in a laboratory. The mass of the fuel removed from the tank was measured by pumping the fuel into a barrel hanging from a load cell. The uncertainty in the induced leak rates was less than 0.01 gal/h. During each test, KWA also verified the magnitude of the induced leak rate by measuring the pump rate with a graduated cylinder and a stop watch.

The volume rates measured by the LRDP are presented in Table 2. As part of the tests, data quality indices automatically checked to verify the quality of the data and to determine whether or not the tank was inadvertently used during the test (e.g., product transfers, or fuel or water sampling). The difference between the measured volume rate and the induced volume rate are also presented in Table 2. The volume rate errors are used to develop the performance of the LRDP system.

3.5 MONITORING PROCEDURES

The third-party evaluation of the LRDP test procedure follows EPA and ASTM standards for conducting and reporting the results of a third-party evaluation [9, 10]. These standards describe the means for demonstrating the performance of bulk tank leak detection systems.

3.6 ANALYTICAL PROCEDURES

The average of a 30-min segment of data obtained by the DP sensor and the AST wall temperature sensor data were used to compute the change in the LRDP volume and the wall volume over a 20-h period. The output of a leak detection test, the TCVR, was computed over this 20-h period as follows:

$$TCVR = [HVC (<LRDP_{End}> - <LRDP_{Start}>) - (<Wall Volume_{End}> - <Wall Volume_{Start}>)]/20,$$

where, the average is denoted by $< >$. More details on the computation can be found in reference[1].

4.0 PERFORMANCE ASSESSMENT

4.1 PERFORMANCE DATA

The performance of the LRDP system was assessed for its suitability for both monthly monitoring and for annual or semiannual precision (tightness) testing of ASTs using the results of many 20-h leak detection tests conducted at both Fairchild AFB and FISC Pearl Harbor. The performance data from the third-party evaluation were used to determine whether or not the performance criteria were met.

4.2 PERFORMANCE CRITERIA

The performance criteria of the DEM/VALs were established by the regulatory guidelines developed in California for detection of leaks in bulk USTs [6] because quantitative standards for ASTs have yet to be developed, but will be no more stringent than those implemented for bulk USTs. The performance of a leak detection method is evaluated and reported in terms of a P_D of a TLR and a P_{FA} . At a minimum, the P_D must be equal to or better than 95%, and the P_{FA} must be less than or equal to 5%. The TLRs for bulk USTs are typically 0.3 to 1.0 for monthly monitoring when a precision test at 0.2 gal/h is performed annually and 1.0 to 2.0 gal/h for monthly monitoring when the precision test is performed semiannually. Whether or not the performance criteria are met is determined by a third-party evaluation. The LRDP system was evaluated for a 20-h test duration.

4.3 DATA ASSESSMENT

Section 4.3.1 describes the results of the third-party evaluation performed by KWA during the DEM/VAL conducted at FISC Pearl Harbor, and Section 4.3.2 describes the results of the tests conducted during the DEM/VAL conducted at the Fairchild AFB to show that leak detection tests can be performed in fixed-roof ASTs with floating pans.

4.3.1 Third-Party Evaluation Results

KWA describes the results of two evaluations of the LRDP for detecting leaks in ASTs in two separate final reports, one for the LRDP-24 Version 2 [15] and one for the LRDP-24-n Version 2 [16]. Five performance estimates are presented for each method, one in the Final Report for that method, and four more in Volume 1: Results Forms. The test logs are also included in Volume 2: Log Sheets.

4.3.1.1 FISC Pearl Harbor Test Results

An example of the ambient level data measured with the LRDP over a 72-h period is shown in Figure 3 as are the thermally induced volume changes produced by the thermal expansion and contraction of the tank wall. The temperature data used to make this estimate were obtained from one resistance temperature device (RTD) mounted on the north wall of the tank. It is clear that the fluctuations in the level data are mainly a function of the thermal expansion and contraction of the wall. However, it is also clear that not all the level changes measured during a complete diurnal cycle are quantitatively explained by this wall estimate, especially during

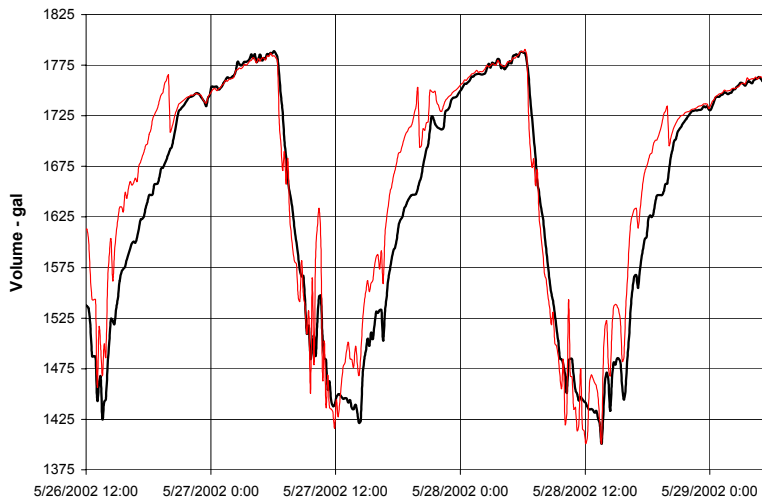


Figure 3. Level and Shell Temperature Data Obtained with the LRDP-24 System During Pre-Evaluation LRDP Tests.

periods when the sun shines directly on the wall of the tank. As a consequence, as described in Section 2.1, a test is begun and ended at night, when the sun cannot produce uneven heating of one side of the tank or another, and only the change in level from one nighttime period to the next is used in the analysis. A test should not be initiated until the entire wall of the tank is uniformly changing temperature which would be several hours after sunset. For these measurements, all tests began and ended after midnight.

There are a variety of explanations for the differences between the measured level (volume) changes with the DP sensor and the level (apparent volume) changes produced by the thermally induced wall changes. First, a single temperature sensor is not adequate to fully characterize the wall temperature changes over the vertical extent of the tank. Second, the model assumed to compute the volume changes produced by the wall as it thermally expands and contracts due to temperature may not be accurate enough. Third, other sources of error, like bottom lift, where the thermal expansion and contraction of the fuel beneath the DP cell are not compensated. However, temperature data obtained at the bottom of the tank indicated that the shaped tube in the bottom three feet of the tank compensated for the bottom lift.

In Figure 3, the level data were converted to volume using the HVC = 13,248.6 gal/in. These data are illustrative of the type of data obtained during the evaluation. It is clear that a test begun at 0530 and ended at 0200 would produce accurate results, but a test begun and ended at noon would not.

The results of the leak detection tests for the LRDP-24 presented in Table 2 are summarized graphically in Figure 4. Each test result is plotted against the leak induced for that test. In Figure 4, the test results measured by the LRDP systems appear on the y-axis, while the KWA-induced leak rates appear on the x-axis. A least-squares line has been fitted to the results of the tests with each LRDP system. The slope of the line is nearly 1.0 (1.019 for all 24 of the evaluation tests and 1.012 for the 11

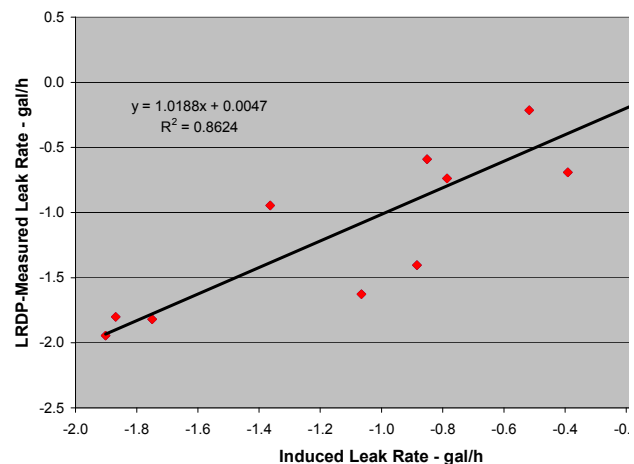


Figure 4. Least-Squares Lines Fitted to the Test Results of the LRDP-24. (Tests conducted with induced leaks are shown in red.)

induced leak evaluation tests); this indicates that volume changes due to the induced leaks are additive with any other volume changes in the tank.

A summary of the statistics of the LRDP-24 determined in the evaluation is presented in Table 3. The performance in terms of P_D and P_{FA} are determined from the standard deviation, S , assuming that the histogram of the noise and signal-plus noise are normally distributed. Once the standard deviation is known, the performance can be computed for any P_D and any P_{FA} .

Table 3. Mean and Standard Deviation of the Difference Between Measured Leak Rates (Test Results) and Induced Leak Rates for the LRDP-24.

Type of LRDP System	Number of Tests	Mean Volume Rate (gal/h)	Standard Deviation (gal/h)
LRDP-24	24	-0.004	0.272

A statistical hypothesis test was performed, as required by the evaluation protocol, to determine if the mean was statistically different from zero. A two-sided student t test was conducted at a level of significance of 0.05. The conclusion of the hypothesis test was that the mean could not be distinguished statistically from zero, and, as a consequence, the method has no bias. This is consistent with the results obtained for the LRDP when used for bulk USTs [3, 4, 11, 12, 15, 16].

The performance of a leak detection system can be affected by the size and geometry of the tank. This relationship is not quantitatively understood for volumetric methods, but is predictable for mass-based systems like the LRDP system. For most mass-based technologies, performance is proportional to the product surface area of the fuel in the tank. According to the evaluation protocol [8, 10], the maximum tank size to which a mass-based method may be applied is determined by the product surface area of the tank, A_{eval} , and is limited to two and one-half times (250%) of the surface area of the tank used in the evaluation. Since the surface area of the 164.5-ft diameter, 6,470,000-gal tank used in this evaluation is 21,253 ft², the LRDP-24 can be used to test tanks with diameters up to 260 ft. The maximum tank capacity (in terms of volume of fuel in the tank) that can be tested with the LRDP systems is not constrained by the evaluation and depends on the height of the tank.

4.3.1.2 Performance Estimates for a Single Test (LRDP-24)

Estimates of the performance of the LRDP-24, in terms of P_D and P_{FA} , were generated for the evaluation tank from the standard deviation, S . The minimum detectable leak rate (MDLR) is tabulated in Table 4 for the 164.5-ft-diameter evaluation tank and is the leak rate that can be detected with a $P_D = 95\%$ and a $P_{FA} = 5\%$. The MDLR is determined from the 24 tests performed in the evaluation by multiplying the standard deviation, S , by 3.428. The 3.428 value is twice the value obtained from a Student's t distribution table for 23 degrees of freedom and a one-tailed test for a level of significance of 0.05 (see reference [8] for more details).

Table 4. Estimate of the MDLR for the LRDP-24 in a 164.5-ft Diameter AST.

Type of LRDP System	Threshold (gal/h)	Leak Rate (gal/h)	Probability of False Alarm (%)	Probability of Detection (%)
LRDP-24	0.466	0.932	5.0%	95.0%

The formula for computing performance of the LRDP-24 (when $n = 1$) and the LRDP-24- n are presented and discussed in the ESTCP Final Report [1]. Version 2 of the method, which is summarized in the final reports prepared by KWA [15, 16], allows the user to select a specific TLR for the tank to be tested in such a way that the $P_D = 95\%$ and the P_{FA} is $\leq 5.0\%$. The P_{FA} will change for each size tank tested if the same TLR is desired.

Four values of the TLR_{eval} were selected to estimate the performance of the LRDP during the third party evaluation: (1) 0.93 gal/h (Version 2.2, MDLR); (2) 1.15 gal/h (Version 2.0, $P_{FA} = 1\%$); (3) 1.86 gal/h (Version 2.1, 2MDLR); (4) 3.5 gal/h (Version 2.0). These TLRs were selected to achieve a certain P_{FA} for a $P_D = 95\%$ and allowed the TLR to scale with tank size without changing the P_D or P_{FA} . For these TLRs, this results in the following P_{FAS} : (1) 5%, (2) 1%, (3) 0.0016%, and (4) very much less than 0.001%. Only four TLRs were selected, because the National Work Group on Leak Detection Evaluations (NWGLDE) allows the performance for only four TLRs to be listed, and these four cover the most typical testing requirements in terms of TLR and P_{FA} . (However, other values of TLR are possible if the tank operator needs to operate the system in a specific manner.)

4.3.1.3 Performance Estimates for More Than One Test (LRDP-24- n)

The performance of the LRDP-24 (or any leak detection system) can be improved significantly by combining the results of two or more tests. Averaging two or more test results before applying the threshold will improve *both* the probability of detection and the probability of false alarm over that obtained for a single test. Performance improves as the number of tests averaged together increases. The performance will depend on the test duration and the number of tests, n , averaged together. For example, the performance of the LRDP-24-4 is a factor of 2.0 (square root of 4) times better than a single 20-h test with the LRDP-24; the LRDP-24-4 uses a test duration of 20 h and averages four 20-h tests together.

The performance of the LRDP-24- n systems, where n is the number of independent tests averaged together, is obtained using the standard deviation of the mean, S_m , test result, S_m , of the LRDP-24, rather than the *standard deviation*, S , obtained from the evaluation, where S_m , is given by

$$S_m = S / (n)^{0.5} .$$

Averaging is important because it allows all the bulk ASTs owned or operated by DoD to meet the precision test requirements of 0.2 gal/h.

4.3.1.4 Summary of Performance Results for Different Size Bulk ASTs

Table 5 presents the largest tank that can be tested (for the number of tests averaged together) to meet the $P_D = 95\%$ and $P_{FA} = 5\%$ specified in the table. Most regulatory agencies require at least this level of performance. The performance results are summarized in Table 5 for the MDLR as a function of tank diameter and the number of tests, n , averaged together. The table indicates the largest tank that can be tested and still maintain the prescribed performance in terms of the P_D and P_{FA} . The performance of the LRDP is proportional to the cross-sectional area of the product surface (i.e., the diameter of the tank) and is inversely proportional to the square root of the

number of independent tests averaged together. Thus, the smaller the area (or tank diameter) and the large the number of tests averaged together, the better the performance.

The MDLR attainable in a single test was computed, as well as that attainable by averaging several tests. The MDLR is the most straightforward way to compare the performance of different methods. The LRDP's MDLR for the tank used in the evaluation (i.e., the one with a diameter 164.5 ft) is 0.932 gal/h, and the threshold (the volume rate at which a leak would be declared) is 0.466 gal/h. The results of this evaluation are applicable to ASTs with diameters up to 260.1 ft.

Table 5. Largest Tank Diameter That Can Be Tested with a $P_D = 95\%$ and a $P_{FA} = 5\%$ as a Function of Leak Rate and Number of Tests (n) Averaged Together.

Leak Rate	Threshold	P_D	P_{FA}	n = 1	n = 2	n = 4	n = 6	n = 12
				Tank Diameter	Tank Diameter	Tank Diameter	Tank Diameter	Tank Diameter
(gal/h)	(gal/h)	(%)	(%)	(ft)	(ft)	(ft)	(ft)	(ft)
0.93	0.466	95%	5%	164.5	195.6	232.6	257.5	≤ 260.1
0.20	0.100	95%	5%	76.2	90.6	107.8	119.3	141.8
0.30	0.150	95%	5%	93.3	111.0	132.0	146.1	173.7
0.50	0.250	95%	5%	120.5	143.3	170.4	188.6	224.3
1.00	0.500	95%	5%	170.4	202.6	241.0	≤ 260.1	≤ 260.1
2.00	1.000	95%	5%	241.0	≤ 260.1	≤ 260.1	≤ 260.1	≤ 260.1

4.3.2 Results of the DEM/VAL of the LRDP in a Fixed-Roof Tank with a Floating Pan

Results from the Fairchild AFB DEM/VAL are presented below. The main purpose of this DEM/VAL was to demonstrate that a fixed-roof AST with a float pan could be tested with the LRDP. A calibration test was performed in which a known volume of fuel was withdrawn from the tank. Nominal volumes of 2, 5, 10, and 15 gal were withdrawn. Figure 5 shows the LRDP-measured level change in inches during the calibration test. The volume of fuel withdrawn is annotated on the figure.

For a 54-ft-diameter tank, the geometrical or theoretical estimate of the HVC for the tank would be 1,427.7 gal/in. Thus, theoretically, a 10-gal withdrawal should result in a 0.0070-in level change, which is about the level shown in Figure 5 for this volume of withdrawal. If the pan stuck and only had two 8-in-diameter openings and a 6-in annual between the floating pan

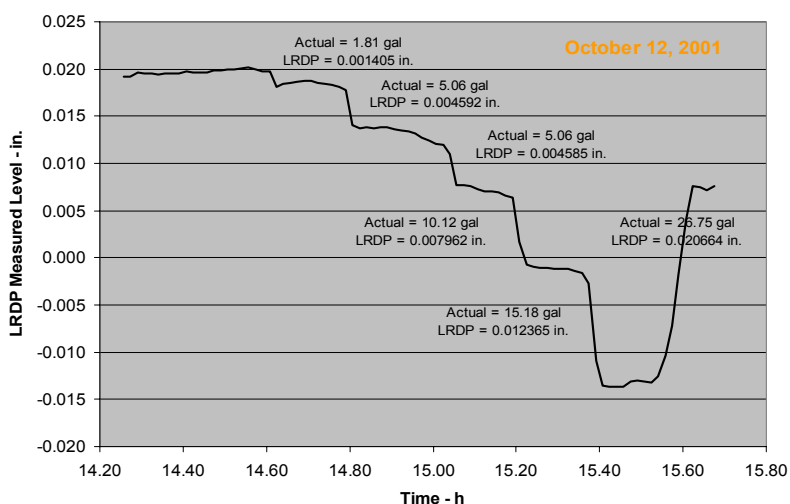


Figure 5. Height-to-Volume Calibration Test Results for the 54-ft-Diameter Fixed-Roof AST with a Floating Pan.

and the inside wall of the tank, the geometrical HVC with the pan stuck would be 26.75 gal/in. This is 53.4 times smaller than the expected HVC of the tank. Thus, a 10-gal withdrawal would result in a 0.374-in-level change if the pan was stuck and did not freely float during the withdrawal. Because a tank operator would assume that the pan does not stick, the geometrical HVC of 1,427.7-gal/in would be applied, and the actual 10-gal withdrawal would appear to produce a 533.7 gal change. Thus, it should be fairly obvious to the tank operator if the pan sticks during a test.

There are two interesting observations about the withdrawals in Figure 5. First, small level changes are easily measured. Even the 1.8-gal withdrawal, which should produce a 0.0012-in level change, is easily discernible. Second, all the withdrawals seem to produce level changes that are slightly higher than expected. The 10-gal withdrawal produces a 0.0079-in change vice the expected 0.007-in change.

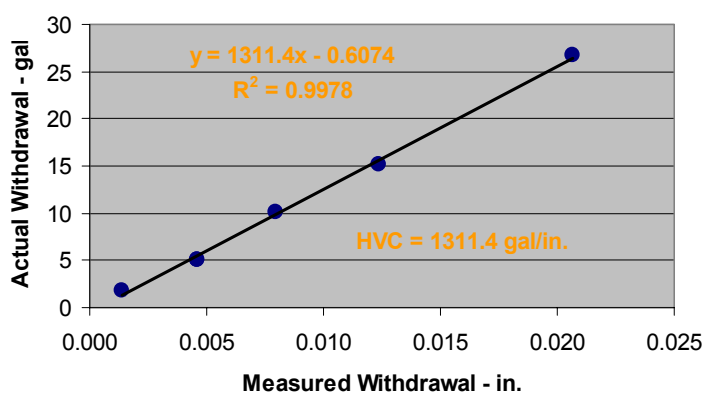


Figure 6. Computation of the HVC from the Calibration Measurements Shown in Figure 7.
(The measured HVC = 1311.4 gal/in.)

Figure 6 shows a plot of the actual withdrawal versus the LRDP-measured level change. The slope of the line, 1,311.4 gal/in, gives the HVC for the tank, which is 8.1% lower than the geometrical calibration. While such an error is not unreasonable for a field check of the HVC, especially if the diameter of the tank is less than 54.0 ft, it is likely that this difference is partially due to some drag caused by the sealing skirt at the pan perimeter and any guides used to prevent pan rotation.

Figure 7 illustrates the results of the first test conducted by KWA. The LRDP-measured volume and the wall volume shown in Figure 7 do not closely trend together during the period from 1500 to 2400 on January 17, 2002. This deviation is due to the thermal expansion and contraction of the fuel at the bottom of the tank that was beneath the bottom of the LRDP system (i.e., the lift volume). This source of error was compensated in the AST used for the third-party evaluation by placing the LRDP on the bottom of the

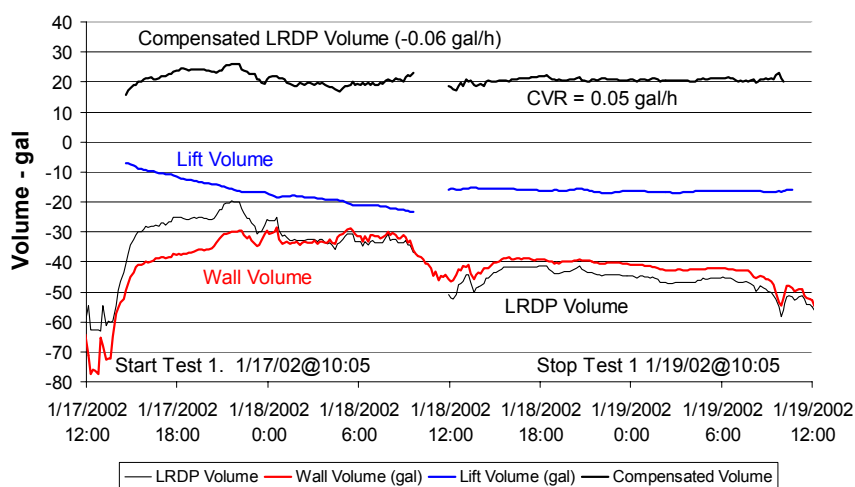


Figure 7. Results of the First Test Conducted by KWA without Introducing an Induced Leak.

tank and shaping the tube [17]. At Fairchild AFB, an estimate of the lift volume was computed using the temperature sensor on the DP sensor, which is inside the sealed container. The TCVR, which is obtained after removing the wall volume and the lift volume from the LRDP-measured volume, is also shown. The TCVR is -0.06 gal/h, which results in a Pass, because the TCVR is less than the threshold.

4.4 TECHNOLOGY COMPARISON

There are seven other types of systems that can be used to detect leaks in ASTs: (1) in-tank tracer systems, (2) testing service mass-based systems, (3) in-tank mass-based systems, (4) constituent fuel tracer systems, (5) in-tank level and temperature monitoring systems, (6) acoustic systems, and (7) statistical inventory reconciliation systems. The last four types of systems, (4) through (7), do not have the accuracy or reliability for use as either a monthly monitoring system or a precision test system for ASTs. The third type of system can meet the monthly monitoring requirements, but does not have the accuracy or reliability to perform a precision test. Only the first two systems can also be used to meet both the monthly monitoring and precision test requirement, but, as described in Section 5, the cost of the test is significantly greater than that of the LRDP.

This page left blank intentionally.

5.0 COST ASSESSMENT

This section summarizes the cost and cost savings achievable with the LRDP for testing bulk ASTs. This section also compares the cost of the LRDP to other in-tank mass-based systems, both in-tank ATGs and portable testing-service systems, and to external tracer-based systems. The cost advantages of the LRDP are realized because of the extremely high performance of the LRDP, the on-line monitoring capability of the LRDP when permanently installed in a tank, the capability of the system to conduct a short test (less than 24 h), and the low recurring costs associated with routine testing to address regulatory requirements. And as explained below, the cost savings are significant.

5.1 COST REPORTING

Two DEM/VALs of the technology were conducted. The approximate costs of these DEM/VALs are summarized in Table 6. The first DEM/VAL was to install an LRDP system in a 10,000-bbl (420,000-gal) bulk AST at Fairchild AFB, and to conduct a series of tests to demonstrate that accurate leak detection tests could be performed in a fixed-roof tank with a floating pan. In the second DEM/VAL, a third-party evaluation of the LRDP was performed in a 150,000-bbl (6,470,000-gal) fixed-roof AST at FISC Pearl Harbor, Hawaii, the largest diameter AST owned by the DoD. The same LRDP system was used for both DEM/VALs. The DEM/VAL costs included an initial site visit, installation, checkout and removal of the equipment, and conducting the DEM/VAL (data collection, analysis, and briefing of the results). The DEM/VALs at Fairchild AFB and FISC Pearl Harbor each required collecting data over a 4-month period. The data for the third-party evaluation was collected between June 19, 2003 and August 29, 2003.

Table 6. Summary of the Costs of the Two DEM/VALs of the LRDP System.

DEM/VAL	Cost of the DEM/VAL	Cost of the Third-Party Evaluation	Total
Fairchild AFB	\$75,000	\$20,000	\$95,000
FISC Pearl Harbor	\$75,000	\$25,000	\$100,000
Total	\$150,000	\$45,000	\$195,000

5.2 COST ANALYSIS

The total life-cycle cost of leak detection includes the following items.

- **Cost of Regulatory Compliance.** Purchase, installation, and operation of a leak detection system (direct and recurring costs).
- **Cost Avoidance**
 - **Fines and Shutdown of Operations.** Costs associated with fines for not being in compliance and the cost impact on operations and operational readiness (direct cost).
 - **Tank Replacement Cost Avoidance.** Premature replacement of tanks (direct cost).

- **Remediation/Cleanup Cost Avoidance.** Cleanup costs due to lack of testing or testing mistakes (direct cost).
- **Commercialization and Technology Transfer Cost.** Commercialization of the pre-production system (direct cost).

It is possible to make an estimate of all of these costs because the performance of the leak detection system is known. The P_D and P_{FA} , which were determined in the third-party evaluation, allow estimates to be made of the cost of testing mistakes, remediation, and tank replacement. The cost of regulatory compliance is described below; the costs associated with cost avoidance, commercialization, and technology transfer are described in Section 6.2.

Regulatory compliance will include the costs associated with the purchase, installation, and use of a leak detection system. It is estimated that the DoD owns or operates approximately 4,000 bulk ASTs with capacities greater than 100,000 gal. The life-cycle cost of a leak detection technology is composed of the elements in Table 7. The startup costs are fixed costs and include those associated with purchase, installation, and operator training. The operation and maintenance (O&M) costs are also fixed but are small for the LRDP. The recurring costs associated with compliance testing and test mistakes are also very small because, once the LRDP is permanently installed, a test can be initiated by pressing a start button, and the performance of the LRDP is very high.

Table 7. Compliance Monitoring Technology Costs for the LRDP on a per Tank Basis.

Direct Environmental Costs				Recurring or Variable Environmental Costs			
Startup		Operation and Maintenance		Compliance Testing		Testing Mistakes	
Equipment cost	\$40,000	Equipment cost	\$40,000	Equipment cost	\$40,000	FA mitigation remediation	\$40,000 \$750,000
Activity	%	Activity	%	Activity	%	Activity	%
Facility preparation, mobilization	\$4,000 (10%)	Labor to operate equipment	\$4000 (10%)	Monthly monitoring	\$400 (1%)	False alarms ($P_{FA} = 1.0\%$)	\$400 (1.0%)
Equipment design	\$4,000 (10%)	Utilities	\$800 (2%)	Annual precision testing	\$400 (1%)	Missed detections*	\$940 (0.125%)
Equipment purchase	\$40,000 (100%)	Consumables and supplies	\$400 (1%)	Facility shutdown costs for testing	\$1,200 (3%)		
Installation	\$8,000 (20%)	Equipment maintenance	\$2,000 (5%)				
Training of operators	\$2,000 (5%)	Training of operators	\$800 (2%)				
Total	\$58,000 (145%)	Total	\$8,000 (20%)	Total	\$2,000 (5%)	Total	\$1,340

* It is assumed that the $P_D = 95\%$ against a TLR = 0.2 gal/h and the number of leaking tanks is 2.5% of the 4,000 bulk ASTs owned by the DoD. While routine testing with the LRDP should decrease the average cost of new remediations, for this calculation, we assumed the average historical remediation cost.

In general, it is not the direct costs that control the price of a leak detection system but the recurring costs of monthly monitoring and annual precision testing. For poor performing systems with a higher than desired P_{FA} , the cost of testing increases for the following reasons:

- Additional tests with the same system or another system must be conducted to distinguish false alarms from leaks.
- Site investigation may be required in terms of monitoring wells to determine whether or not the tank is actually leaking.
- Such false declarations may have to be reported to regulatory authorities with all the ramifications of such a report.
- The activities required to determine whether or not a failed test is a false alarm will shut down facility operations until the false alarm can be resolved.

If the P_{FA} is unacceptably high, operational experience indicates that fuel farm personnel often do not operate or trust the equipment, and therefore, leaks may go undetected. This can be very costly because of the remediation costs associated with undetected leaks.

Table 7 summarizes the costs associated with regulatory compliance with the LRDP. A Parts List for the LRDP is presented in Section 6.4 of the Final Report [1]. The purchase price of an LRDP assumed for this estimate is based on the purchase of 10 in-tank sensor units. Table 7 presents the cost model in terms of a percentage of the equipment purchase price. The costs of false alarms and missed detections are based on an assumed price for additional testing (\$500) and an average remediation cost (\$750,000 per incident). The average remediation cost is based on 890 remediation jobs performed by the Navy. These two costs are indicated in the table heading. It is assumed that the P_{FA} is 1.0%, and that the probability of a missed detection is probability of missed detect (P_{MD}) = $1 - P_D = 5\%$ for a target leak rate of 0.2 gal/h. It is further assumed for this computation that 2.5% of all of the bulk ASTs owned by the military are leaking. Because small leaks can be detected with the LRDP, the large average cost of remediation can be greatly reduced (e.g., 25% of the average cost); for this calculation, however, it is assumed that the cost of remediation is equal to the average cost.

An important cost is the cost of shutdown associated with testing and testing mistakes (false alarm investigations). Since the military is not selling fuel commercially, any short-term or permanent shut down of fueling operations is difficult to quantify in terms of dollars. However, it is unacceptable to shutdown military operations, or to seriously impact operational readiness. An estimate of \$40,000 for an FA mitigation was used in Table 7, resulting in a \$400 per tank cost at a P_{FA} of 1.0%. The total cost per tank is \$69,340. A cost comparison of the LRDP and tracer and other mass-measurement systems is given in Section 5.3.

5.3 COST COMPARISON

The LRDP has several significant cost advantages over other technologies. An estimate of the cost savings realized by the LRDP over three other methodologies is shown in Table 8, Table 9,

and Table 10. Method 1 represents an in-tank tracer method with monthly monitoring. It is well documented that this method has a high recurring cost for compliance testing. Method 1 assumes that a tracer must be added to the tank; no cost estimate is provided for tracer methods that use constituents in the fuel as tracers because their performance has been found to be unacceptable. Method 2 is an in-tank, mass-based method that is assumed to have the capability to meet the annual precision test and the monthly monitoring requirements, but only as a testing service. Method 3 is an in-tank, mass-based, ATG method that has the capability to meet only the monthly monitoring requirements. It is assumed that another method, like the LRDP or the in-tank tracer method, is used to meet the annual precision test. No other permanently installed in-tank, mass-based system besides the LRDP has the capability to meet an annual precision test performance standard (at 0.2 gal/h). No specific commercial methods are identified by brand name here. The cost savings achieved with the LRDP over the in-tank tracer method (Method 1) is mainly due to the very much smaller recurring cost of testing with the LRDP than with the tracer method. The main cost savings achieved with the LRDP over other in-tank, mass-based methods that can meet only the annual precision and monthly monitoring requirement as a testing service (Method 2) is the large, recurring monthly cost of the service. The main cost savings achieved with the LRDP over other in-tank, mass-based ATG methods (Method 3) are due to the fact that the LRDP can be used to conduct an annual precision test, while the other in-tank systems cannot. The best way to interpret the tables is to examine the relative cost savings between the LRDP and the other methods. The calculation uses the fixed start-up costs and the recurring compliance testing costs from Table 7 for the LRDP.

The cost comparison calculation is done as follows. First, it was assumed that the start-up and O&M costs are the same for all permanently installed methods. Established price lists for bulk leak detection systems are not generally available or very meaningful, because most product sales or testing jobs are performed under a unique contract bid. This computation assumes \$40,000, which is higher than anticipated for the LRDP and lower than typically charged for Method 3. This estimate includes the one-time purchase of the equipment for \$40,000 (same as for the LRDP), as well as the same O&M costs, and the same cost of testing and testing mistakes. While the equipment and O&M costs are assumed to be the same for the calculation, a one-time purchase of equipment can be as high as \$75,000 for other mass-based systems, and the other mass-based methods typically have a higher probability of testing mistakes than the LRDP. Second, a mobilization charge was added for each site visit to conduct a test at a facility for those methods that are based on a testing service. However, the mobilization charge used for the monthly monitoring tests was reduced, as appropriate, over that of the annual visit. Also, the mobilization was the same for each facility, regardless of the number of tanks tested at that facility. Third, the real cost savings of the testing tend to be controlled by the recurring cost of testing (i.e., experienced with a monthly testing service), or the cost of additional testing because of the lack of capability of the method to satisfy *both* the monthly monitoring and the annual precision test. The estimate assumes that 12 monthly tests and one annual precision at 0.2 gal/h are conducted each year. Fourth, there are significant cost savings associated with cost avoidance and remediation/cleanup when accurate and reliable leak detection is being performed. It is safe to say that the DoD would realize significant cost savings (many hundreds of millions of dollars) if any leak detection system were installed and used. However, if a reliable and accurate leak detection system were used, like the LRDP, these savings could be a factor of 2 to 5 times greater. The cost savings that could be realized by cost avoidance and lower remediation

costs are *not* included in this calculation. Fifth, this cost comparison does not include the costs of testing mistakes. The number of tests to be conducted each year will be increased (1) if the leak detection system is susceptible to false alarms, or (2) if tests need to be repeated because they are too long and must be prematurely terminated or because they interfere with operations. Again, the LRDP has a real advantage in terms of performance but this advantage is not included in this comparison.

Table 8 summarizes the cost of the testing a 100-ft-diameter AST with each of the methods listed for the first AST tested at a bulk storage facility and for additional ASTs tested at that facility. Table 8 summarizes, as appropriate, the initial purchase and installation of the leak detection system, the cost of performing 12 monthly tests, and the cost of performing an annual precision test. It is assumed that the first test and the mobilization for the first AST tested at a facility, which includes the initial site preparation and/or annual maintenance checkout, costs significantly more than the remaining 11 monthly monitoring tests. The mobilization is applied only to the facility and is the same regardless of the number of ASTs tested at that facility. However, it is also assumed that the mobilization for the monthly tests is reduced over that charged for the first test at a facility. It is also assumed that the first test on any AST tested at that facility may have a different (higher) price than the remaining 11 monthly tests.

Table 8. Cost Comparison of Testing with Monthly Monitoring and Annual Precision Test for First and Additional Bulk ASTs at a Single Facility or Fuel Farm for the First Year.

	Purchase of System	Monthly Monitoring			Precision Test	Total	Total
	Initial Purchase for One UST System	Cost of First Test on Any AST Tested & One-Time Facility Mobilization	Cost of Each Monthly Test & Mobilization on First AST at a Facility	Cost of Additional ASTs Tested at a Facility w/o Mobilization	Annual Cost of a Precision Test	Annual Cost of Compliance for Year 1 for the First AST at a Facility	Annual Cost of Compliance for Year 1 for Additional ASTs at a Facility
Method 1 (In-tank tracer testing service/ installation)	0	\$6,200 & \$8,000	\$3,750 & \$4,000	\$3,750 & 0		\$99,450	\$47,450
Method 2 (In-tank testing service)	0		\$8,000 & \$8,000	\$8,000 & \$5,000	\$16,000	\$159,000	\$96,000
Method 3 (In-tank ATG)	\$40,000	\$480 & 0	\$480 & 0	\$480 & 0		\$61,760	\$61,760
LRDP	\$40,000	\$480 & 0	\$480 & 0	\$480 & 0		\$45,760	\$45,760
Method 1/LRDP						\$2.2M	\$1.0M
Method 2/LRDP						\$3.5M	\$2.1M
Method 3/LRDP						\$1.3M	\$1.3M

Table 9 summarizes the total cost of meeting the regulatory requirements for a single bulk AST for all four methods. For comparison, the ratio of the cost of each method relative to the LRDP is given in the tables. Clearly, the recurring cost of the monthly tests associated with Method 1 and Method 2 dominate the cost of testing. Table 10 summarizes the cost for a fuel farm containing six bulk ASTs. A factor of two cost savings is observed for the two testing-service methods over that of using these methods for testing only one AST at a facility. These cost savings are realized because only one mobilization cost is charged when more than one tank or

test is conducted at the same facility. However, the total cost of these methods is still significantly higher than the LRDP, and do not change much more even if 10 or 20 ASTs are tested at a facility. The total cost savings throughout DoD would be significantly higher if all 4,000 ASTs were included in the estimate.

Table 9. Cost Comparison of Testing with Monthly Monitoring and Annual Precision Test for the First Bulk AST at a Facility for 1, 3, 5, and 10 Years.

Testing Method	Total Cost of Compliance for			
	First Year	3 Years	5 Years	10 Years
Method 1 (In-tank tracer)	\$99,450	\$298,350	\$497,250	\$994,500
Method 2 (In-tank testing service)	\$192,000	\$576,000	\$960,000	\$1,920,000
Method 3 (In-tank ATG)	\$61,760	\$105,280	\$148,800	\$257,600
LRDP	\$45,760	\$57,280	\$68,800	\$97,600
Method 1/LRDP	\$1.9M	\$3.1M	\$3.9M	\$5.0M
Method 2/LRDP	\$3.5M	\$8.3M	\$11.6M	\$16.3M
Method 3/LRDP	\$4.2M	\$10.1M	\$14.0M	\$19.7M

As presented in Table 9, over a 10-year period, the cost of the two methods (Method 1 and Method 2) for testing an AST at a facility requiring monthly tank preparations or monthly visits, when compared to the LRDP, is a factor of 10 to 20 higher than the LRDP when only one AST is tested. When multiple ASTs are tested, as presented in Table 10 for a six-AST facility, the cost saving is a factor of 5 to 10 higher than the LRDP. The LRDP has at least a 3 to 1 advantage over the lower performing in-tank, mass-based ATG (Method 3).

The savings of the LRDP compared to Method 1 and Method 2 would result in a payback period of less than 1 year, and the savings compared to Method 3 would result in a payback period of approximately 3 years, even without including the savings due to fewer tank replacements and lower remediation costs and the inconvenience of having a testing service come in annually.

Table 10. Cost Comparison of Testing with Monthly Monitoring and Annual Precision Test for Six Bulk ASTs at a Facility for 1, 3, 5, and 10 Years.

Testing Method	Total Cost of Compliance for			
	First Year	3 Years	5 Years	10 Years
Method 1 (In-tank tracer)	\$336,700	\$1,010,100	\$1,683,500	\$3,367,000
Method 2 (In-tank testing service)	\$672,000	\$2,016,000	\$3,360,000	\$6,720,000
Method 3 (In-tank ATG)	\$370,560	\$631,680	\$892,800	\$1,545,600
LRDP	\$274,560	\$343,680	\$412,800	\$585,600
Method 1/LRDP	\$1.9M	\$3.1M	\$3.9M	\$5.0M
Method 2/LRDP	\$2.3M	\$5.6M	\$7.7M	\$10.9M
Method 3/LRDP	\$2.4M	\$5.9M	\$8.1M	\$11.5M

6.0 TECHNOLOGY IMPLEMENTATION

6.1 COST OBSERVATIONS

DoD owns more than 4,000 ASTs of varying capacities. While the leak detection requirements for ASTs were deferred in EPA's UST regulation issued on September 22, 1988, many of the states have or are in the process of requiring testing of such tanks. Although federal regulations have deferred ASTs from monthly monitoring and/or annual precision testing, state regulators are now imposing stringent leak-detection requirements. This presents a unique problem for the DoD, because it owns and operates a large number of bulk ASTs, and no on-line system currently exists that can perform monthly monitoring tests and an annual precision test. The requirement for testing may cost many tens to hundreds of millions of dollars, depending on the testing approach used. In comparison to other technologies, the LRDP can realize significant cost savings for the DoD. The average cost of the LRDP is a factor of 3 to 11 times less than competing technologies.

The cost of compliance and a comparison of the costs between the LRDP and other methods were described in Section 5. Discussions of the additional cost savings that can be realized due to cost avoidance, and commercialization/technology transfer are presented in Sections 6.1.1 and 6.1.2, respectively.

6.1.1 Cost Avoidance

The magnitude of the cost savings that can be realized by minimizing testing mistakes, managing tank replacement efforts and minimizing remediation/clean-up efforts through early detection of a release is a direct function of the use and performance of the leak detection system. If equipment is used frequently and the performance is high (i.e., the probabilities of false alarm and missed detection are low), then the need to routinely replace tanks can be minimized. They can continue to be used with confidence that they are not leaking and, if a leak develops, that it will be quickly detected. This reduces the volume of fuel released into the ground and the scope and cost of the cleanup. The high performance of the LRDP means that the number of false alarms and missed detections will be much smaller than other technologies. Furthermore, the high performance of the LRDP allows the probability of false alarm of the system to be set to a very low level without sacrificing the detection of small leaks. The other mass-based systems and some tracer-based approaches do not have the performance to operate with a low probability of false alarm. In addition, other mass-based methods must operate at a higher target leak rate. The total cost savings that can be realized by implementing a reliable leak detection program can be \$500 million to \$1 billion dollars. These cost savings are described below.

Fines and Shutdown of Operations. The cost of testing more than offsets the cost of the fines that may be levied if the tanks are not tested within the specified regulatory guidelines and are out of compliance. Fines may be \$25,000 per day per facility, or more. Ultimately, if the bulk ASTs are not in compliance, fuel operations can be shut down. Since the military is not selling fuel, any permanent or short-term shutdown of fueling operations is difficult to quantify in terms of dollars. However, it is unacceptable to shutdown military operations, or to seriously impact operational readiness. Because the LRDP has the capability to perform both the monthly

monitoring and the annual precision test, it is the most cost-effective way to be in compliance. Because in many instances, an LRDP test can be performed in 20 h rather than the 48 or 72 h required by other methods, the impact on shutdown is significant.

Tank Replacement Cost Avoidance. Most bulk ASTs are expensive to replace; the costs per tank can be many millions to tens of millions of dollars. Replacement costs can be minimized, avoided, or delayed by using accurate and reliable leak detection. The use of accurate and reliable leak detection can justifiably and safely avoid premature replacement of tanks. The cost savings associated with the use of leak detection are very large. If we assume that the cost of replacement is \$5 per gallon of stored fuel, it would cost approximately \$10,000,000 to replace a 70-ft-diameter AST. The cost of adding a double bottom and interstitial leak detection might be \$500,000 as compared to adding an LRDP at \$70,000. Regardless, leak detection is an inexpensive alternative to tank replacement.

Remediation/Cleanup Cost Avoidance. The cost of remediation and cleanup are by far the largest costs associated with leaking tanks, and clean-up cost avoidance can be the most significant cost savings realized with the purchase, installation, and use of reliable leak detection. It is difficult to estimate the portion of the costs associated with clean-up that can be avoided, but it is significant. The Navy has 659 future leaking underground fuel tank (LUFT) sites to clean up and has estimated that the total cost will be \$890,000,000. Early detection of leaks can significantly reduce the total cost of cleanup because the concentration and spatial extent of the plume is smaller than it would be if the leak were not detected early.

6.1.2 Commercialization and Technology Transfer

The costs associated with technology transfer and commercialization are relatively low for the LRDP because the third-party evaluation has already been completed. At the present time, the NWGLDE, which lists properly evaluated leak detection systems for USTs, is not listing leak detection systems for ASTs. This may change in the future, and the LRDP has been evaluated in accordance with the NWGLDE test procedures. One company, Vista Research, Inc., has already commercialized the pre-production system.

6.2 PERFORMANCE OBSERVATIONS

All of the performance objectives of this program were met. The LRDP was successfully demonstrated in two DEM/VALs. The evaluated performance obtained in the third-party evaluation during the DEM/VAL at FISC Pearl Harbor is sufficient to address all the regulatory requirements for DoD's bulk ASTs, because it meets the regulatory requirements for bulk USTs. The results of the DEM/VAL on the fixed-roof tank at the Fairchild AFB indicates that the system can be used to test ASTs with floating pans.

6.3 SCALE-UP

The DEM/VALs were all conducted on full-scale, operational ASTs. The DEM/VALs were conducted on one of the, if not the, largest diameter AST owned by DoD. The performance of the LRDP in other tanks scales with tank diameter (or equivalently, the product surface area of

the fuel in the tank). As the tank diameter decreases, the performance improves and smaller leak rates can be detected. Based on the third-party evaluation, the LRDP can be used to test tanks with capacities as small as 50,000 gal and with diameters as large as 260 ft, which includes all of the ASTs owned by DoD, and all but a few of the ASTs that exist in the petroleum industry.

6.4 OTHER SIGNIFICANT OBSERVATIONS

All tank operations must cease during a test; no fuel transfers in or out of the tank are allowed. This temporary shutdown of the tank is minimized by the LRDP in comparison to other in-tank leak detection systems, because the duration of the test is shorter than the other methods. The LRDP can meet the monitoring and precision regulatory requirements in a 20-h test. The other technologies typically require 48 to 72 h, and, other than the LRDP, none of the permanently mounted in-tank systems have sufficient performance to perform a precision test.

6.5 LESSONS LEARNED

In order to conduct a leak detection test with this technology, the tank must be isolated from the piping associated with the tank. Thus, it is important that all valves at the tank be completely sealed before a test is initiated. This is particularly important when conducting a precision test at 0.2 gal/h. Many of the valves at DoD facilities are double-block and bleed valves, which allow a visual check of the seal and a measurement of the flow across the valve if it does not seal. The monthly monitoring standards are sufficiently large in comparison to the performance of the LRDP that small valve leaks can be tolerated during a test without impacting the results. No waiting period is required for conducting a leak detection test with a mass-based system like the LRDP.

6.6 END-USER ISSUES

The LRDP is ready for commercialization and has been evaluated for performance by a third party. Vista Research, Inc., has commercialized the LRDP and is now offering products and services based on the LRDP implemented using a PLC. Product description and product specification sheets are available (in an Appendix of the Final Report [1]). Immediate commercialization of this technology has been possible because fuel terminal operators were involved during the demonstrations and the bulk storage tank facilities have a real need to address. Some limited sales of the LRDP have already occurred. For example, the LRDP has been used to test an AST at Point Loma and a chemical tank (containing sodium hydroxide) at an industrial facility.

At the request of NFESC during this ESTCP project, a workshop was conducted by the Environmental Technology Evaluation Center (EvTEC) of the Civil Engineering Research Foundation (CERF) to introduce the technology and to describe the advantages of the system for regulatory compliance [18]. Technical experts and representatives from the petroleum industry, the Defense Energy Support Center (DESC), and the U. S. Air Force, Army, and Navy were present.

6.7 APPROACH TO REGULATORY COMPLIANCE AND ACCEPTANCE

At the present time, ASTs are not strongly regulated and regulatory standards have not been established. It is clear from public and private forums that many states are developing such regulations or regulatory guidelines. SPCC plans and American Petroleum Institute (API) 653 inspections encourage leak detection but stop short of requiring it. However, the SPCC encourages leak detection testing by allowing an increased interval between inspections. Also, leak detection has been found to be useful in verifying that a tank is leak-free before it is brought back into service after an API 653 inspection. As a consequence, the evaluation was conducted and the results reported to meet the two practical regulatory guidelines for using in-tank, mass-based measurements in California for bulk USTs, which were developed and recommended by NFESC and Vista Research (Options 7 and 10).

It was assumed that the regulatory requirements for ASTs would be similar and no more stringent than those for bulk USTs [8]. Option 7 requires monthly monitoring tests with a system capable of detecting a leak between 1.0 and 2.0 gal/h with a $P_D \geq 95\%$ and a $P_{FA} \leq 5\%$, and a semiannual precision test with a method capable of detecting a leak of 0.2 gal/h with the same P_D and P_{FA} as for the monthly monitoring test. Option 10 is similar to Option 7, except the monthly monitoring criteria is 0.3 to 1.0 gal/h, and the precision test need only be conducted annually. While the precision test requirement of 0.2 gal/h is stringent, it is achievable by the LRDP and for many tanks with only a single test. The monthly monitoring requirements of 0.3 to 1.0 gal/h or 1.0 to 2.0 gal/h are operationally practical and easily met by the LRDP.

The approach to regulatory requirement depends on the size of the tank to be tested, as was discussed in Section 4. The main recommendation is to operate the system such that the regulatory requirements can be met with the lowest probability of false alarm. Given the choice, the monthly monitoring should be addressed using the largest target leak rate possible less than 2.0 gal/h. This minimizes any minor system problems that may otherwise interfere with a test (i.e., a small flow across a valve).

7.0 REFERENCES

1. L. A. Karr, W. R. Pickett, and J. W. Maresca, Jr. Aboveground Storage Tank Leak Detection and Monitoring. ESTCP Final Report. Naval Facilities Engineering Service Center, 1100 23rd Avenue, Port Hueneme, CA 93043-4370, and Vista Engineering Technologies, L.L.C., 8203 W. Quinault, Kennewick, WA 99336, January 2004.
2. L. A. Karr, J. W. Maresca, Jr., and W. R. Pickett. Validation of the Low-Range Differential Pressure (LRDP) Leak Detection System in Bulk Fuel Aboveground Storage Tanks (ASTs) Paper #69914, Air and Waste Management Association, 2003.
3. L. A. Karr, W. R. Major, J. W. Maresca, Jr., J. W. Starr, and G. A. Hayter. Validation of the Low Range Differential Pressure (LRDP) Leak Detection System for Small Leaks in Bulk Fuel Tanks. ESTCP Cost and Performance Report. Naval Facilities Engineering Service Center, 1100 23rd Avenue, Port Hueneme, California 93043-4370, and Vista Research, Inc., 755 North Mary Avenue, Sunnyvale, CA 94085, 25 April 2001.
4. L. A. Karr, W. R. Major, J. W. Maresca, Jr., J. W. Starr, and G. A. Hayter. Validation of the Low Range Differential Pressure (LRDP) Leak Detection System for Small Leaks in Bulk Fuel Tanks. ESTCP Final Report. Naval Facilities Engineering Service Center, 1100 23rd Avenue, Port Hueneme, CA 93043-4370, and Vista Research, Inc., 755 North Mary Avenue, Sunnyvale, CA 94085, 25 April 2001.
5. U.S. Environmental Protection Agency. 40 CFR 280-Technical Standards and Corrective Action Requirements for Owners and Operators of Underground Storage Tanks. Federal Register, Vol. 53, No. 185, 23 September 1988.
6. California Water Resources Control Board. Local Guidance Letters LG 151-2. 22 October 1999.
7. U.S. Environmental Protection Agency. 40 CFR 112.8 and 112.11–Spill Prevention, Control, and Countermeasures (SPCC) Regulation. EPA 540-K-02-006 and OSWER 9360.8-52, October 2002.
8. U.S. Environmental Protection Agency. Alternative Test Procedures for Evaluating Leak Detection Methods: Evaluation of Bulk Field Constructed Tanks. Region VII, Memorandum, March 1996.
9. American Society of Testing Materials. Standard Practice for Evaluating the Performance of Release Detection Systems for Underground Storage Tank Systems (ASTM E 1526 - 93) in Annual Book of ASTM Standards, Philadelphia, American Society of Testing and Materials, May 1993.
10. Ken Wilcox Associates, Inc. Alternative Test Procedures for Evaluating Leak Detection Methods: Mass-Based Leak Detection Systems for Aboveground Storage Tanks Larger than 50,000 Gallons. Evaluation Protocol, November 2002.

11. J. W. Maresca, Jr., and J. W. Starr. The LRDP System for Detection of Leaks in Bulk Storage Tanks. Final Report, prepared for the Naval Facilities Engineering Service Center, 1100 23rd Avenue, Port Hueneme, CA 93043-4370, prepared by Vista Research, Inc., 100 View Street, Mountain View, CA 94042, 25 March 1998.
12. National Work Group on Evaluation of Leak Detection Methods. List of Leak Detection Evaluations for Underground Storage Tank Systems. Office of Underground Storage Tanks, U.S. Environmental Protection Agency, 7th Edition, April 2000.
13. W. Major, L. Karr, G. Warren, and J. Norbutas. Red Hill Fuel Tank Leak Detection. Proceedings of the Seventh (1997) International Offshore and Polar Engineering Conference, Honolulu, HI, Naval Facilities Engineering Service Center, Port Hueneme, CA, 25-30 May 1997.
14. L. A. Karr, W. R. Major, J. W. Maresca, Jr., M. J. Talhami, J. W. Starr, and R. F. Wise. Pre-Production Initiative: Low Range Differential Pressure (LRDP) Leak Detection System — Red Hill Test Results. Final Report. Naval Facilities Engineering Service Center, 1100 23rd Avenue, Port Hueneme, CA 93043-4370 and Vista Engineering Technologies, L.L.C., 8203 W. Quinault, Kennewick, WA 99336, 31 July 2001.
15. J. K. Wilcox. Evaluation of the LRDP-24 on Aboveground Storage Tanks: Final Report. Third-Party Evaluation Report, prepared for the Naval Facilities Engineering Service Center and Vista Research, Inc., prepared by Ken Wilcox Associates, Inc., 1125 Valley Ridge Drive, Grain Valley, MO 64029, 18 December 2002.
16. J. K. Wilcox. Evaluation of the LRDP-24-n on Aboveground Storage Tanks: Final Report. Third-Party Evaluation Report, prepared for the Naval Facilities Engineering Service Center and Vista Research, Inc., prepared by Ken Wilcox Associates, Inc., 1125 Valley Ridge Drive, Grain Valley, MO 64029, 18 December 2002.
17. J. W. Maresca, Jr., System and Method for Leak Detection in Liquid Storage Tanks. U.S. Patent No. 4,646,560, Vista Research, Inc., Palo Alto, CA, 3 March 1987.

APPENDIX A

POINTS OF CONTACT

Point of Contact	Organization	Phone/Fax/E-mail	Role in Project
Leslie A. Karr, REM Program Manager	Naval Facilities Engineering Service Center (NFESC) 1100 23rd Avenue Port Hueneme, CA 93043-4370	(805) 982-1618 (805) 982-4304 karrla@nfesc.navy.mil	Project Manager
William R. Major Project Engineer	Naval Facilities Engineering Service Center (NFESC) 1100 23rd Avenue Port Hueneme, CA 93043-4370	(805) 982-1808 (805) 982-4304 majorwr@nfesc.navy.mil	Project Engineer
Dr. Joseph W. Maresca, Jr. Vice President	Vista Research, Inc. 755 North Mary Avenue Sunnyvale, CA 94086	(408) 830-3306 (408) 830-3399 maresca@vrinc.com	Technical Director, Industry Partner
James W. Starr, P. E. Staff Engineer	Vista Research, Inc. 139 Glendale Avenue Edison, NJ 08817	(732) 777-2100 (732) 777-9495 jstarr@vrinc.com	Project Engineer
Dr. H. Kendall Wilcox President	Ken Wilcox Associates, Inc. 1125 Valley Ridge Drive Grain Valley, MO 64029	(816) 443-2494 (816) 443-2495 kwilcox@kwaleak.com	Third-Party Evaluator
Mr. H. Jeffrey Wilcox Engineer	Ken Wilcox Associates, Inc. 1125 Valley Ridge Drive Grain Valley, MO 64029	(816) 443-2494 (816) 443-2495 mail: jwilcox@kwaleak.com	Third-Party Evaluator
Col. Patrick L. Fink U.S. Air Force	Randolph Air Force Base San Antonio, TX	(210) 652-6375	DEM/VAL Liaison
Jim Gammon FISC, Pearl Harbor	FISC, Pearl Harbor Pearl Harbor, HI	(805) (805) Jgammon@	DEM/VAL Liaison
Rick Rosa, Civil/Environmental Division Head	Fairchild Air Force Base 92 CES/CEV 100 W. Ent Street Suite 155 Fairchild AFB, WA 99011	(509) 247-2313)	DEM/VAL Liaison
Paul Rodgers	Defense Energy Office – Los Angeles Defense Energy Supply Center (DESC) John J. Kingman Road, Suite 4950 Fort Belvoir, VA 22060-6222	(702) 767-8313 (703) 767-8331 proddgers@desc.dla.mil	DEM/VAL Liaison
William Middleton	Defense Energy Office – Los Angeles Defense Energy Supply Center (DESC) John J. Kingman Road, Suite 4950 Fort Belvoir, VA 22060-6222	(702) 767-8313 (703) 767-8331 wmiddleton@desc.dla.mil	DEM/VAL Liaison



ESTCP Program Office

**901 North Stuart Street
Suite 303
Arlington, Virginia 22203
(703) 696-2117 (Phone)
(703) 696-2114 (Fax)
e-mail: estcp@estcp.org
www.estcp.org**